



## Unmatched Adapter Error

-Newer Adapters are not supported on older programmers

EX: SP5000/e & SP6000/e

### Solution


1. First remove the 8 screws from the bottom of the SuperPro Programmer and remove the bottom cover.



2. After removing the bottom cover, now you have access to the all of the PCB board. First PCB you will see which is the power board. Look for the highlighted area (R6).



3. On the right side of the power board you will find the R6. Please replace the R6 with the parts with value of 3.4kohm, 0805 package. If can't find an 0805 package, you can use a 0603 package which is slightly smaller, just have add a little more solder, but do not add to much solder to avoid shorting the next component, R5,U3 or C18.

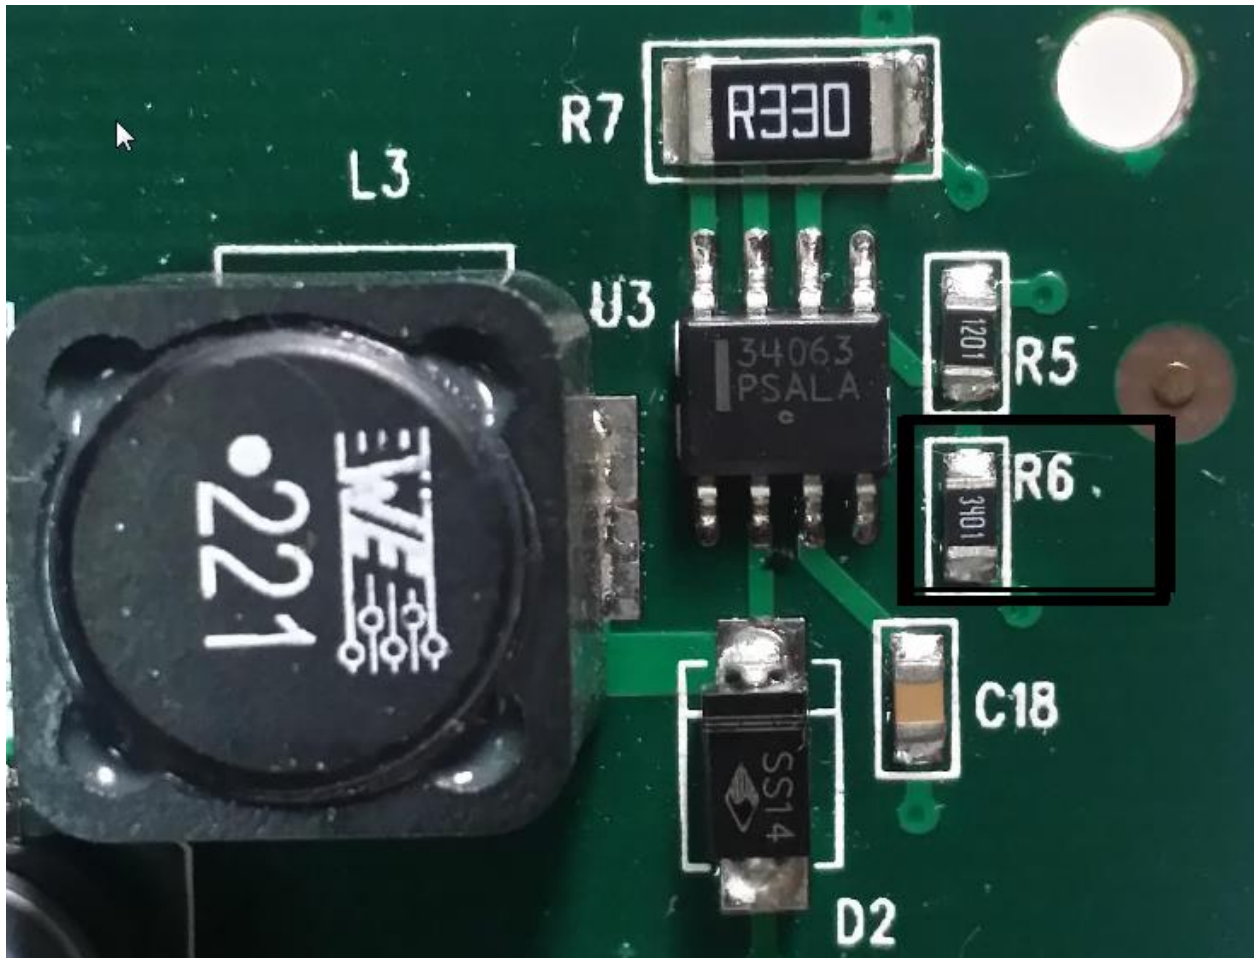

4. After replacing the R6, you should be able to use the new socket adapter.

For any further questions please email [Aaron@Xeltek.com](mailto:Aaron@Xeltek.com)